


PRUŽINY

Tlačné pružiny

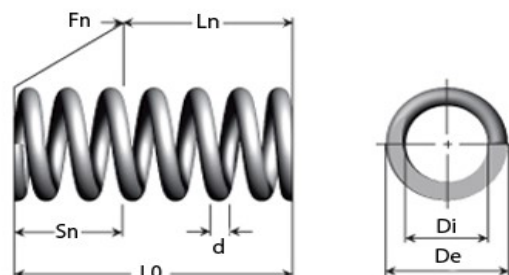

TLAČNÉ PRUŽINY						
Průměr drátu d (mm)	Vnější průměr pružiny De (mm)	Délka pružiny v nezátíženém stavu L0 (mm)	Délka pružiny při max. deformaci Ln (mm)	Počet z závitů z	Síla potřebná pro max. deformaci pružiny Fn (N)	Tuhost pružiny c (N/mm)
0,9	7,9	11,5	6,4	5		5,57
		18,0	9,9	7		3,54
		25,5	13,0	10	28,60	2,29
		37,0	18,7	14		1,56
		53,5	26,3	20		1,05
	9,9	16,0	7,1	5		2,62
		24,0	10,0	7		1,67
		35,5	13,8	10	23,40	1,08
		51,5	19,6	14		0,73
		75,0	27,8	20		0,50
	12,4	22,0	8,2	5		1,26
		33,5	11,8	7		0,80
		50,5	17,0	10	17,30	0,52
		73,5	24,3	14		0,35
		106,0	33,2	20		0,24
1,0	6,0	8,5	6,6	5		23,24
		12,0	9,0	7		14,81
		17,0	12,6	10	43,74	9,57
		24,0	17,4	14		6,51
		34,5	24,6	20		4,40
	7,3	10,0	7,3	5		11,57
		14,5	10,1	7		7,39
		21,5	14,3	10	34,13	4,79
		30,5	19,9	14		3,26
		43,5	28,3	20		2,20
	9,0	13,0	7,3	5		5,68
		19,0	10,1	7		3,61
		28,5	14,3	10	33,15	2,33
		40,5	19,9	14		1,59
		59,0	28,3	20		1,08
	11,0	17,5	8,0	5		2,90
		26,0	11,2	7		1,85
		39,0	16,0	10	27,36	1,20
		56,0	22,4	14		0,81
		81,5	32,0	20		0,55