


PRUŽINY

Tlačné pružiny

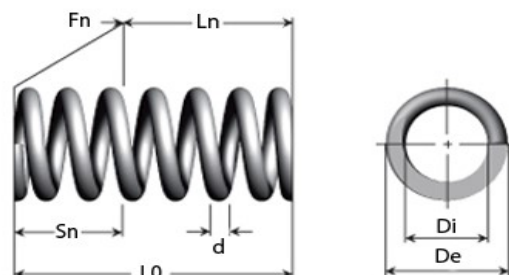

TLAČNÉ PRUŽINY						
Průměr drátu d (mm)	Vnější průměr pružiny De (mm)	Délka pružiny v nezátíženém stavu L0 (mm)	Délka pružiny při max. deformaci Ln (mm)	Počet z závitů z	Síla potřebná pro max. deformaci pružiny Fn (N)	Tuhost pružiny c (N/mm)
3,0	18,0	26,0	16,8	5		69,86
		37,5	23,1	7		44,45
		55,5	33,2	10	641,80	28,76
		79,0	46,2	14		19,56
		113,5	64,9	20		13,22
	21,5	31,5	17,8	5		37,24
		47,0	25,4	7		23,70
		70,5	37,2	10	510,80	15,33
		100,0	51,0	14		10,43
		148,0	75,5	20		7,04
	26,5	40,5	18,0	5		18,17
		61,0	25,7	7		11,56
		91,0	36,4	10	408,50	7,48
		130,5	50,2	14		5,09
		190,0	71,1	20		3,44
	33,0	56,0	19,2	5		8,73
		84,5	26,7	7		5,56
		129,5	40,1	10	321,30	3,60
		183,0	51,6	14		2,45
		268,5	74,0	20		1,65
	40,5	79,0	21,9	5		4,47
		120,5	30,8	7		2,85
		184,5	45,8	10	255,30	1,84
		266,5	62,6	14		1,25
		392,0	90,2	20		0,85
3,2	19,2	27,5	17,8	5		74,33
		40,0	24,9	7		47,37
		59,0	35,4	10	720,79	30,69
		83,5	49,0	14		20,79
		120,0	69,4	20		14,12
	23,2	33,5	18,5	5		38,15
		49,5	25,9	7		24,22
		74,0	37,1	10	576,63	15,69
		105,0	51,6	14		10,69
		155,0	73,2	20		7,21