


PRUŽINY

Tlačné pružiny

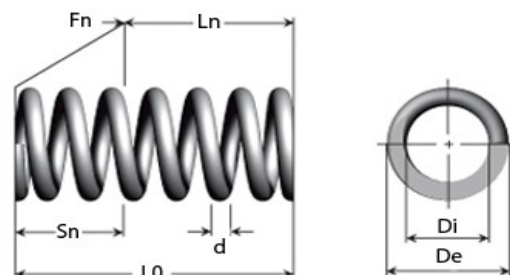

TLAČNÉ PRUŽINY						
Průměr drátu d (mm)	Vnější průměr pružiny De (mm)	Délka pružiny v nezátíženém stavu L0 (mm)	Délka pružiny při max. deformaci Ln (mm)	Počet z závitů z	Síla potřebná pro max. deformaci pružiny Fn (N)	Tuhost pružiny c (N/mm)
3,2	28,2	42,5	19,1	5		19,42
		63,5	26,3	7		12,36
		94,5	37,1	10	460,91	8,02
		135,0	51,6	14		5,45
		200,0	73,2	20		3,68
	35,2	58,5	19,8	5		9,31
		88,5	27,4	7		5,92
		135,0	38,8	10	360,88	3,82
		190,0	54,1	14		2,61
		280,0	77,0	20		1,76
	43,2	82,0	21,2	5		4,76
		125,0	29,7	7		3,03
		190,0	42,3	10	288,32	1,96
		275,0	59,2	14		1,33
		405,0	84,5	20		0,90
3,6	21,6	30,5	19,9	5		83,83
		44,5	27,9	7		53,35
		65,5	39,9	10	884,80	34,52
		94,5	56,8	14		23,47
		135,0	79,2	20		15,86
	26,1	37,0	20,5	5		42,92
		55,0	29,1	7		27,31
		81,5	41,5	10	706,30	17,67
		118,0	59,2	14		12,02
		170,0	83,0	20		8,12
	32,1	48,0	21,6	5		21,12
		71,0	29,5	7		13,44
		107,5	43,4	10	557,80	8,70
		152,5	58,2	14		5,91
		225,0	85,4	20		4,00
	39,6	64,5	22,3	5		10,48
		97,0	30,7	7		6,67
		147,5	45,1	10	441,80	4,31
		211,5	61,0	14		2,93
		320,0	97,1	20		1,98