


PRUŽINY

Tlačné pružiny

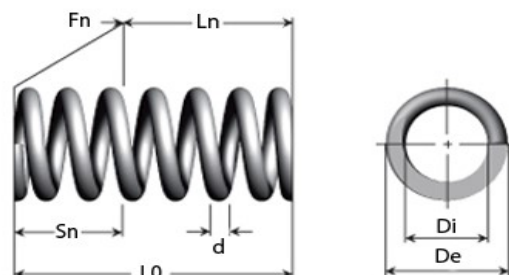

TLAČNÉ PRUŽINY						
Průměr drátu d (mm)	Vnější průměr pružiny De (mm)	Délka pružiny v nezátíženém stavu L0 (mm)	Délka pružiny při max. deformaci Ln (mm)	Počet z závitů z	Síla potřebná pro max. deformaci pružiny Fn (N)	Tuhost pružiny c (N/mm)
4,5	33,0	46,0	26,1	5		51,56
		67,5	36,2	7		32,81
		100,0	51,6	10	1028,60	21,23
		145,0	73,8	14		14,44
		207,5	102,1	20		9,75
	40,5	59,0	27,2	5		25,58
		87,5	37,5	7		16,28
		130,0	52,7	10	814,80	10,53
		187,5	73,8	14		7,16
		275,0	106,7	20		4,84
	49,5	78,0	28,2	5		13,10
		117,5	39,3	7		8,34
		177,5	56,6	10	652,00	5,39
		257,5	79,7	14		3,67
		375,0	111,9	20		2,48
	61,0	110,5	32,1	5		6,62
		165,0	41,8	7		4,21
		255,5	65,0	10	519,00	2,72
		365,0	84,9	14		1,85
		537,5	123,0	20		1,25
5,0	30,0	41,0	27,6	5		116,70
		60,0	38,5	7		74,04
		87,5	54,9	10	1569,06	47,86
		125,0	76,7	14		32,59
		180,0	109,0	20		21,97
	37,0	51,0	28,7	5		55,41
		75,0	40,2	7		35,30
		110,0	57,5	10	1225,83	22,85
		160,0	80,5	14		15,49
		230,0	115,0	20		10,49
	45,0	64,0	29,6	5		28,34
		95,5	41,1	7		18,04
		140,0	58,4	10	980,67	11,67
		205,0	81,4	14		7,94
		300,0	116,0	20		5,36