


PRUŽINY

Tlačné pružiny

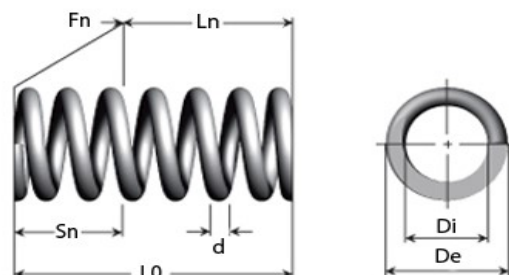

TLAČNÉ PRUŽINY						
Průměr drátu d (mm)	Vnější průměr pružiny De (mm)	Délka pružiny v nezátíženém stavu L0 (mm)	Délka pružiny při max. deformaci Ln (mm)	Počet z závitů z	Síla potřebná pro max. deformaci pružiny Fn (N)	Tuhost pružiny c (N/mm)
2,5	15,0	22,0	14,0	5		58,35
		32,0	19,5	7		37,17
		47,5	27,8	10	467,78	24,03
		67,5	38,7	14		16,28
		98,0	55,1	20		10,98
	18,5	27,5	14,6	5		27,75
		41,0	20,5	7		17,65
		61,0	29,3	10	364,81	11,47
		88,0	41,1	14		7,78
		130,0	58,9	20		5,25
	22,5	36,0	15,5	5		14,22
		54,0	21,9	7		9,05
		81,5	31,5	10	292,24	5,85
		120,0	44,3	14		3,98
		175,0	63,6	20		2,69
	27,5	49,0	16,8	5		7,29
		74,5	24,0	7		4,64
		115,0	34,8	10	233,40	3,00
		165,0	49,2	14		2,04
		240,0	70,8	20		1,38
	34,5	71,5	19,3	5		3,48
		110,0	27,9	7		2,22
		170,0	41,0	10	182,40	1,43
		245,0	58,1	14		0,97
		360,0	83,9	20		0,66
2,8	14,0	20,5	16,4	5		127,49
		29,0	22,3	7	518,77	77,40
		45,9	34,9	10		46,88
		71,4	53,3	14		28,73
	20,0	27,2	16,4	5		35,11
		39,5	22,5	7	379,52	22,36
		64,2	34,9	10		12,94
	30,0	47,0	17,9	5	258,90	8,88
		70,7	24,9	7		5,65