


PRUŽINY

Tlačné pružiny

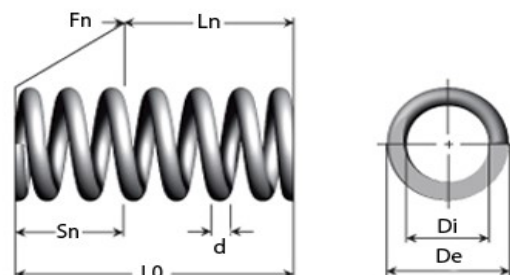

TLAČNÉ PRUŽINY						
Průměr drátu d (mm)	Vnější průměr pružiny De (mm)	Délka pružiny v nezátíženém stavu L0 (mm)	Délka pružiny při max. deformaci Ln (mm)	Počet z závitů z	Síla potřebná pro max. deformaci pružiny Fn (N)	Tuhost pružiny c (N/mm)
1,0	13,5	24,0	9,4	5	21,97	1,49
		36,5	13,4	7		0,95
		55,5	19,4	10		0,61
		80,5	27,4	14		0,41
		115,0	39,4	20		0,28
1,25	7,6	12,0	7,2	5	133,37	29,03
		17,0	9,8	7		18,04
		25,0	13,8	10		11,77
		35,5	19,2	14		8,09
		51,5	27,1	20		5,39
	9,3	15,0	7,4	5	104,93	14,32
		22,0	10,5	7		8,92
		33,0	14,9	10		5,83
		47,5	21,0	14		3,96
		69,0	30,0	20		2,69
	11,3	20,0	7,7	5	85,42	7,09
		29,5	10,8	7		4,51
		44,5	15,2	10		2,92
		64,0	21,1	14		1,99
		93,5	30,0	20		1,34
	13,8	27,0	8,2	5	69,04	3,63
		41,5	11,6	7		2,31
		62,5	16,5	10		1,49
		90,5	23,1	14		1,02
		130,0	32,9	20		0,69
	17,3	40,5	9,1	5	54,23	1,73
		62,0	12,9	7		1,10
		94,0	18,5	10		0,72
		140,0	26,0	14		0,48
		205,0	37,3	20		0,32
1,4	8,4	13,5	8,4	5	165,00	32,60
		19,0	11,0	7		20,75
		28,0	15,7	10		13,42
		40,5	22,4	14		9,13
		58,5	31,7	20		6,17