


PRUŽINY

Tlačné pružiny NEREZOVÉ

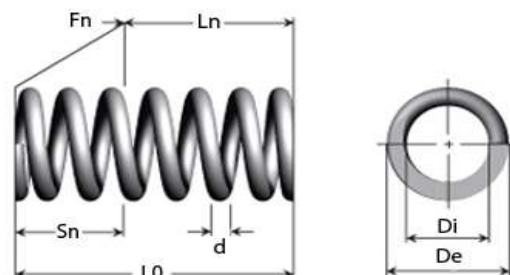

TLAČNÉ PRUŽINY - NEREZ OCEĽ						
Průměr drátu d (mm)	Vnější průměr pružiny De (mm)	Délka pružiny v nezátíženém stavu L0 (mm)	Délka pružiny při max. deformaci Ln (mm)	Počet z závitů z	Síla potřebná pro max. deformaci pružiny Fn (N)	Tuhost pružiny c (N/mm)
1,4	10,4	17,0	8,5	5		12,78
		25,0	11,6	7		8,13
		37,0	16,3	10	108,70	5,26
		53,0	22,6	14		3,58
		77,0	32,0	20		2,42
	12,9	22,0	7,6	5		6,12
		33,0	10,4	7		3,90
		49,0	14,1	10	88,00	2,52
		71,0	19,7	14		1,71
		104,5	28,5	20		1,16
	15,4	30,5	10,0	5		3,39
		46,5	14,2	7		2,16
		70,0	20,1	10	69,70	1,40
		100,5	27,1	14		0,95
		147,5	38,9	20		0,64
	18,9	44,5	12,7	5		1,74
		68,0	18,1	7		1,11
		102,0	24,8	10	55,20	0,72
		152,5	39,0	14		0,49
		222,5	54,5	20		0,33
1,6	9,6	14,5	9,0	5		31,04
		21,5	12,6	7		19,77
		31,5	17,9	10	174,00	12,83
		45,0	24,8	14		8,66
		65,5	35,2	20		5,87
	11,6	18,5	9,4	5		15,93
		27,0	13,2	7		10,13
		40,5	18,9	10	141,32	6,56
		58,5	26,5	14		4,44
		85,0	37,9	20		3,01
	14,1	24,0	10,0	5		8,13
		36,0	14,1	7		5,19
		53,5	20,1	10	112,73	3,37
		78,0	28,0	14		2,27
		115,0	39,9	20		1,54