


PRUŽINY

Tlačné pružiny NEREZOVÉ

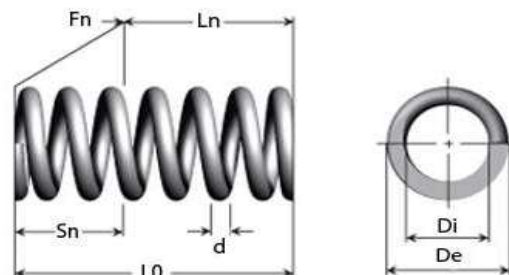

TLAČNÉ PRUŽINY - NEREZ OCEL						
Průměr drátu d (mm)	Vnější průměr pružiny De (mm)	Délka pružiny v nezátíženém stavu L0 (mm)	Délka pružiny při max. deformaci Ln (mm)	Počet z závitů z	Síla potřebná pro max. deformaci pružiny Fn (N)	Tuhost pružiny c (N/mm)
0,9	7,9	11,5	6,4	5		4,64
		18,0	9,9	7		2,95
		25,5	13,0	10	23,80	1,91
		37,0	18,7	14		1,30
		53,5	26,3	20		0,88
	9,9	16,0	7,1	5		2,18
		24,0	10,0	7		1,39
		35,5	13,8	10	19,50	0,90
		51,5	19,6	14		0,61
		75,0	27,8	20		0,41
	12,4	22,0	8,2	5		1,05
		33,5	11,8	7		0,67
		50,5	17,0	10	14,40	0,43
		73,5	24,3	14		0,29
		106,0	33,2	20		0,20
1,0	6,0	8,5	6,6	5		19,36
		12,0	9,0	7		12,34
		17,0	12,6	10	36,43	7,97
		24,0	17,4	14		5,42
		34,5	24,6	20		3,67
	7,3	10,0	7,3	5		9,64
		14,5	10,1	7		6,16
		21,5	14,3	10	28,43	3,99
		30,5	19,9	14		2,71
		43,5	28,3	20		1,83
	9,0	13,0	7,3	5		4,73
		19,0	10,1	7		3,01
		28,5	14,3	10	27,61	1,94
		40,5	19,9	14		1,32
		59,0	28,3	20		0,90
	11,0	17,5	8,0	5		2,42
		26,0	11,2	7		1,54
		39,0	16,0	10	22,79	1,00
		56,0	22,4	14		0,68
		81,5	32,0	20		0,46