


PRUŽINY

Tlačné pružiny NEREZOVÉ

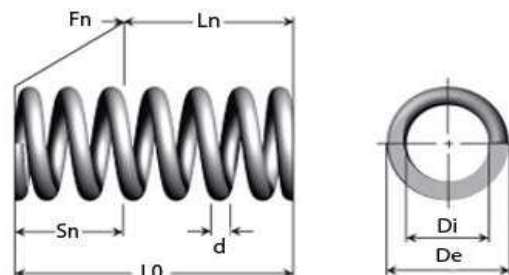

TLAČNÉ PRUŽINY - NEREZ OCEĽ						
Průměr drátu d (mm)	Vnější průměr pružiny De (mm)	Délka pružiny v nezátíženém stavu L0 (mm)	Délka pružiny při max. deformaci Ln (mm)	Počet z závitů z	Síla potřebná pro max. deformaci pružiny Fn (N)	Tuhost pružiny c (N/mm)
1,0	13,5	24,0	9,4	5	18,30	1,24
		36,5	13,4	7		0,79
		55,5	19,4	10		0,51
		80,5	27,4	14		0,34
		115,0	39,4	20		0,24
1,25	7,55	12,0	7,2	5	111,10	24,18
		17,0	9,8	7		15,03
		25,0	13,8	10		9,80
		35,5	19,2	14		6,74
		51,5	27,1	20		4,49
	9,25	15,0	7,4	5	87,41	11,93
		22,0	10,5	7		7,43
		33,0	14,9	10		4,86
		47,5	21,0	14		3,30
		69,0	30,0	20		2,24
	11,25	20,0	7,7	5	71,15	5,91
		29,5	10,8	7		3,76
		44,5	15,2	10		2,43
		64,0	21,1	14		1,66
		93,5	30,0	20		1,12
	13,85	27,0	8,2	5	57,51	3,02
		41,5	11,6	7		1,93
		62,5	16,5	10		1,24
		90,5	23,1	14		0,85
		130,0	32,9	20		0,57
	17,25	40,5	9,1	5	45,17	1,44
		62,0	12,9	7		0,91
		94,0	18,5	10		0,60
		140,0	26,0	14		0,40
		205,0	37,3	20		0,27
1,4	8,4	13,5	8,4	5	137,40	27,16
		19,0	11,0	7		17,28
		28,0	15,7	10		11,18
		40,5	22,4	14		7,60
		58,5	31,7	20		5,14