


PRUŽINY

Tlačné pružiny NEREZOVÉ

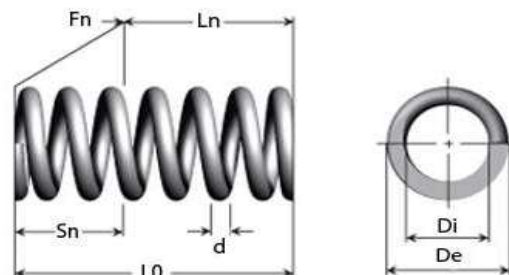

TLAČNÉ PRUŽINY - NEREZ OCEĽ						
Průměr drátu d (mm)	Vnější průměr pružiny De (mm)	Délka pružiny v nezátíženém stavu L0 (mm)	Délka pružiny při max. deformaci Ln (mm)	Počet z závitů z	Síla potřebná pro max. deformaci pružiny Fn (N)	Tuhost pružiny c (N/mm)
3,6	48,6	90,5	24,7	5	294,20	4,47
		137,5	34,0	7		2,84
		210,0	50,1	10		1,84
		305,0	69,9	14		1,25
		447,5	99,5	20		0,85
4,0	24,0	33,5	22,2	5	890,41	77,52
		49,0	31,0	7		49,34
		72,0	44,2	10		31,94
		105,0	61,7	14		21,73
		150,0	87,7	20		14,62
	29,0	41,0	22,9	5	709,88	39,70
		60,5	32,2	7		25,24
		89,5	46,0	10		16,34
		130,0	64,5	14		11,11
		185,0	92,1	20		7,52
	36,0	53,5	24,0	5	554,67	18,95
		79,5	33,3	7		12,01
		120,0	47,2	10		7,78
		170,0	65,8	14		5,29
		250,0	93,6	20		3,58
	44,0	71,0	25,2	5	443,57	9,72
		105,0	35,1	7		6,17
		160,0	50,0	10		3,99
		235,0	69,8	14		2,71
		340,0	99,6	20		1,83
	54,0	99,0	27,4	5	355,35	4,96
		150,0	38,6	7		3,15
		230,0	55,4	10		2,04
		335,0	77,8	14		1,39
		490,0	111,0	20		0,94
4,5	27,0	37,5	25,0	5	1087,10	87,29
		54,5	34,9	7		55,55
		79,5	49,3	10		35,94
		115,0	70,5	14		24,44
		165,0	99,2	20		16,51