


PRUŽINY

Tažné pružiny

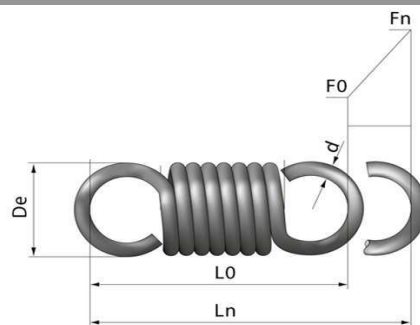

TAŽNÉ PRUŽINY						
Průměr drátu d (mm)	Vnější průměr pružiny De (mm)	Délka pružiny v nezátíženém stavu Lo (mm)	Délka pružiny při max. deformaci Ln (mm)	Počet z závitů z	Síla potřebná pro max. deformaci pružiny Fn (N)	Tuhost pružiny c (N/mm)
0,7	3,5	11,1	2,36	10	30,7	11,10
		15,3	3,78	16		6,95
		21,6	5,90	25		4,44
	5,0	13,5	6,25	10	22,6	3,07
		17,7	10,00	16		1,92
		24,0	15,60	25		1,23
		34,5	25,00	40		0,77
	7,5	17,5	16,90	10	15,4	0,78
		21,7	27,00	16		0,49
		28,0	42,20	25		0,31
		38,5	67,50	40		0,20
		52,5	101,00	60		0,13
0,8	4,0	12,6	2,66	10	39,9	12,70
		17,4	4,26	16		8,00
		24,6	6,66	25		5,10
	5,5	15,0	6,40	10	30,2	4,00
		19,8	10,20	16		2,50
		27,0	16,00	25		1,60
		39,0	25,60	40		1,00
		290,0	225,00	60		0,11
	9,0	20,6	21,40	10	19,0	0,76
		25,4	34,30	16		0,47
		32,6	53,50	25		0,30
		44,6	85,60	40		0,19
		60,6	128,00	60		0,13
0,9	4,5	14,2	2,95	10	49,7	14,30
		19,6	4,72	16		8,96
		27,7	7,38	25		5,73
	6,3	17,1	7,43	10	37,1	4,23
		22,5	11,90	16		2,65
		30,6	18,60	25		1,70
		44,1	29,70	40		1,06
	10,0	23,0	23,10	10	24,0	0,88
		28,4	36,90	16		0,55
		36,5	57,60	25		0,35
		50,0	92,20	40		0,23
		68,0	138,00	60		0,15